


MINIMUM JOINT GAP FOR
FULL 180° HINGE OPENING
VARIES AS DOOR THICKNESS
CHANGES (SEE CHART BELOW)

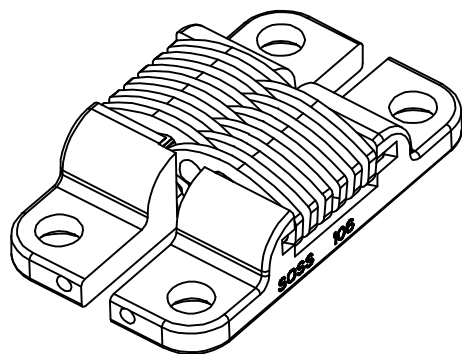

1/4" DIA HOLE
3/8" DIA x 82° C'SINK

13/64"
HINGE GAP

HINGE CLOSED
FRONT VIEW

HINGE OPEN 180°
FRONT VIEW


HINGE CLOSED
TOP VIEW

OPEN

JOINT GAP CHART

DOOR THICKNESS	MINIMUM JOINT GAP
14 GAUGE (.075")	7/64"
16 GAUGE (.060")	3/32"
18 GAUGE (.048")	5/64"
20 GAUGE (.036")	1/16"

DO NOT SCALE DRAWING
ALL DIMENSIONS ARE IN INCH

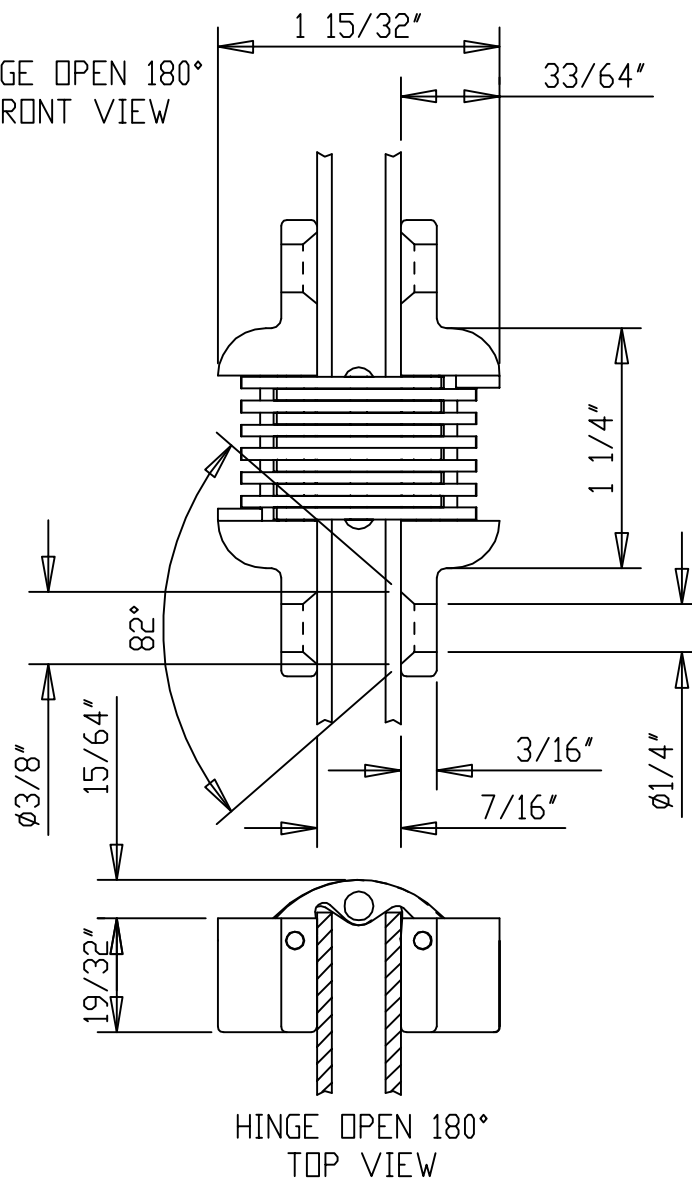

UIIP

©Copyright
Universal Industrial Products, Inc.
One Coreway Drive
Pioneer, Ohio 43554-0628

SCALE: 1 = 1

DRAWN BY: LHH

HINGE TEMPLATE

DATE: 5/04/17

#106MT SOSS INVISIBLE HINGE

DRAWING #106MT